

## FSP-951-IV Series Photoelectric Detectors Operating in CLIP Protocol


DATE: February 13, 2019

Document: SB19-02-01

NOTIFIER has identified a safety issue with the FSP-951-IV, FSP-951R-IV and FSP-951T-IV photoelectric detectors operating in CLIP and manufactured between March 30, 2018 through January 14, 2019. Date code range 8034 through 9013. When these models are used in conjunction with the NOTIFIER ONYX NFS-3030 and NFS2-3030 Fire Alarm Control Panels (FACP) operating in CLIP they have the potential to not properly communicate a fire alarm condition in certain fire scenarios such as a fast, flaming fire.

**FSP-951-IV Series photoelectric detectors operating in CLIP within the affected date range must be immediately removed from service and replaced.** Any inventory must be returned for credit. This Safety Bulletin should be communicated to the site coordinator of all potentially impacted installations.

Example device product label

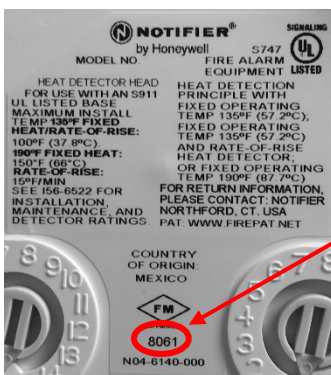

Example device carton label



4-digit date code

This Safety Bulletin is being conducted in cooperation with the U.S. Consumer Product Safety Commission



The FSP-951-IV Series smoke detectors are capable of operating in either FlashScan or CLIP protocol and with other NOTIFIER FACP's. However, it is only this **specified configuration** that will not properly communicate a fire alarm condition in certain fire scenarios and therefore should NOT be used.

**WARNING: FSP-951-IV, FSP-951R-IV and FSP-951T-IV photoelectric detectors within the affected date range should NEVER be configured in CLIP operation with the NFS-3030 or NFS2-3030 FACP's. Detectors used in this configuration will not properly communicate a fire alarm condition in certain fire scenarios such as fast, flaming fire.**

NOTIFIER has taken the appropriate steps to prevent recurrence and units manufactured after 9013 are not affected. Our goal is to resolve this issue as efficiently as possible and we apologize for the inconvenience.

To place an order for replacement devices and to obtain an RMA to return of the affected devices please contact NOTIFIER Customer Service. Technical questions regarding this bulletin should be directed to NOTIFIER Technical Support at 1-800-289-3473 or [NOTIFIER.Tech@honeywell.com](mailto:NOTIFIER.Tech@honeywell.com)